

Replacement Instructions






e-SVI

Cartridge mechanical seal


Motor



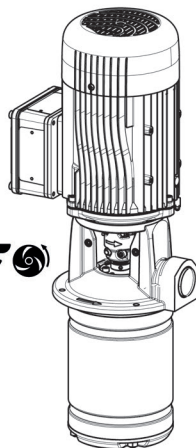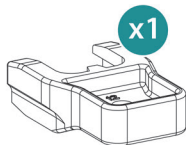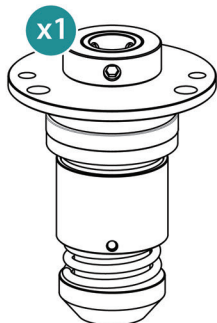


SVI_V0001_A_ph


1

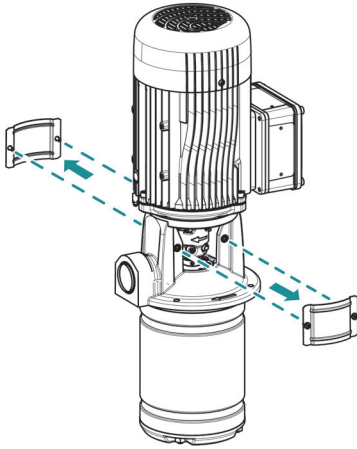


2

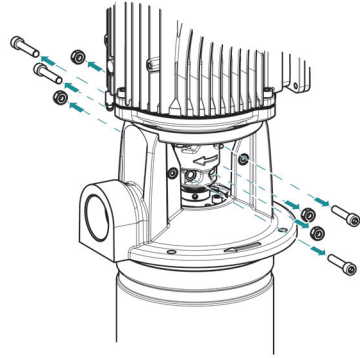


3

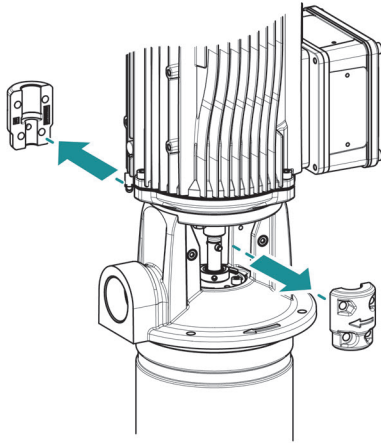


4

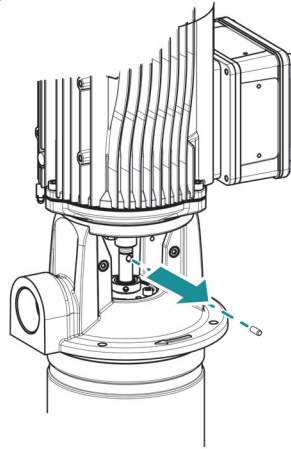


5

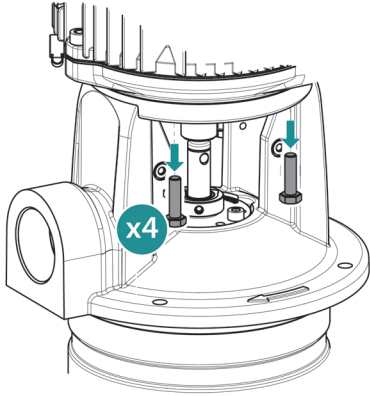


6

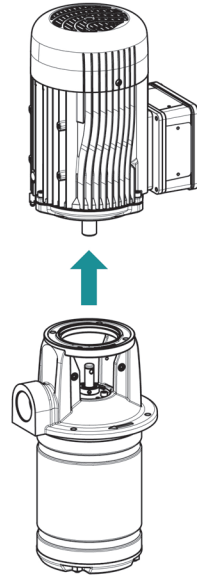


7

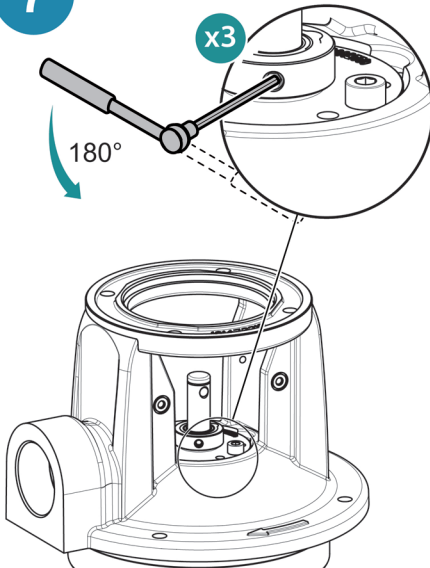


8

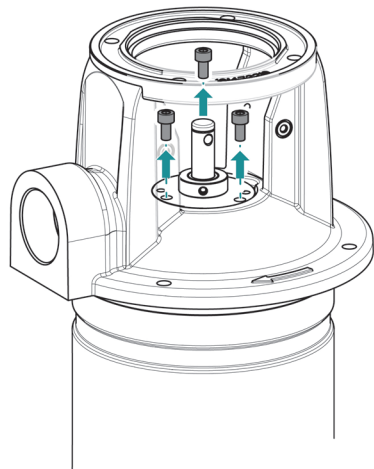


9

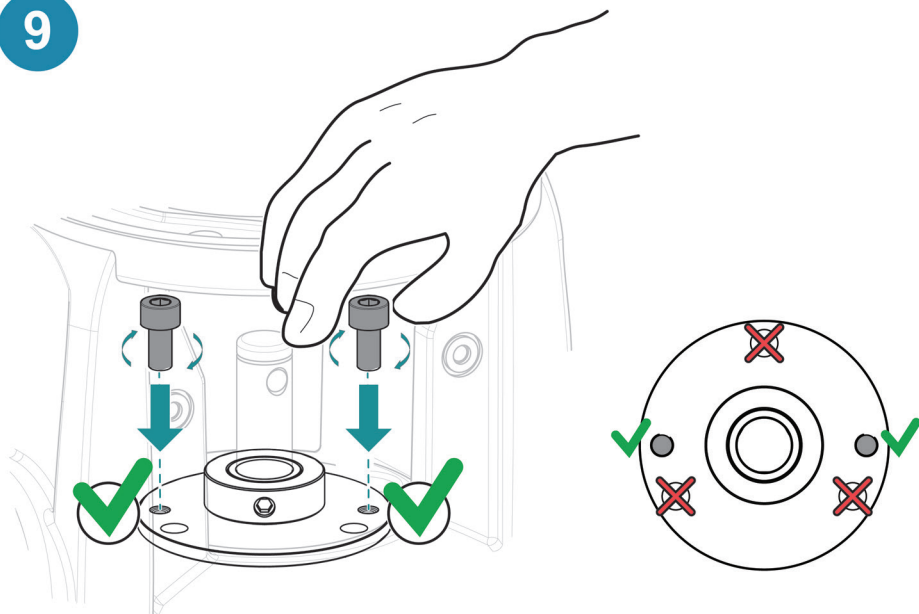

10

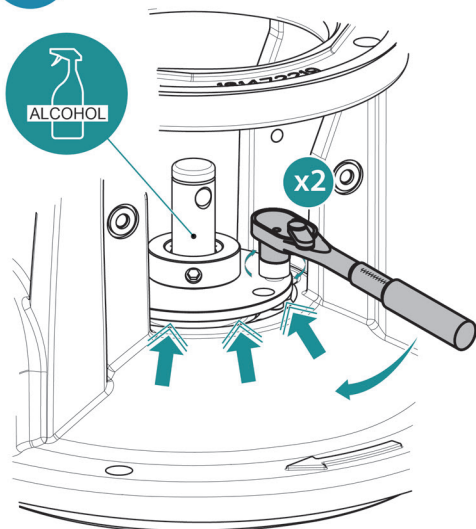


11

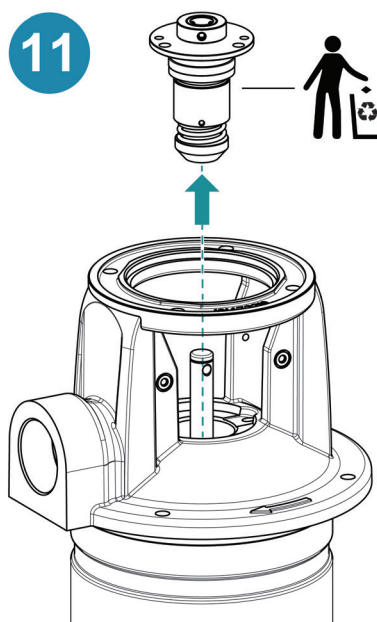


SVL_V0004_A_ph


12

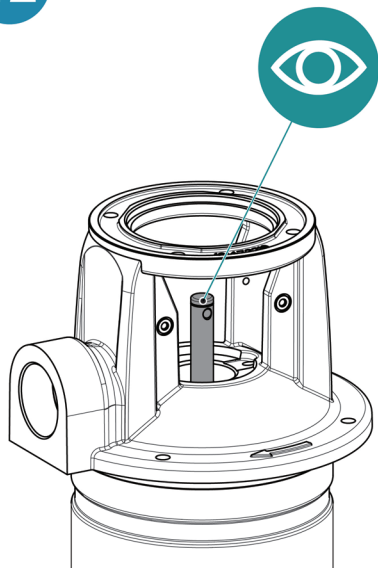


13

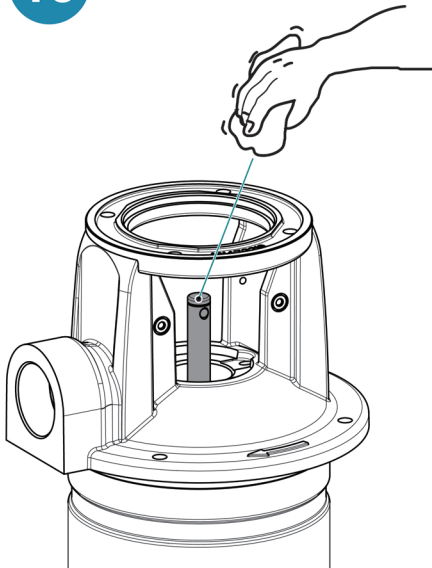

14

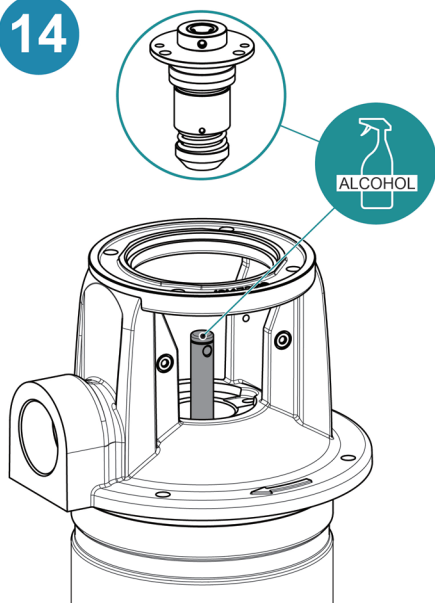


15

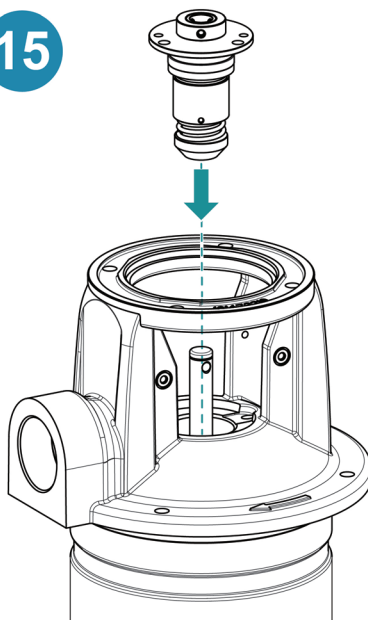


16


 6 Nm (53 lbf-in)

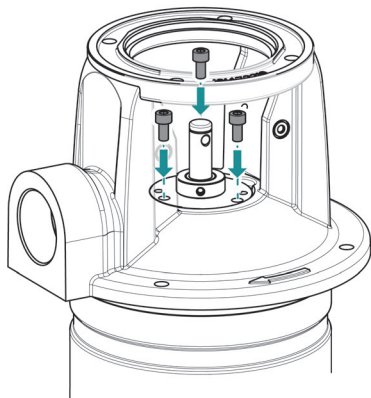


17

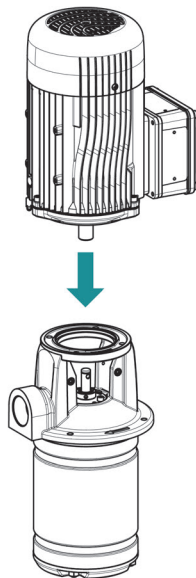

18

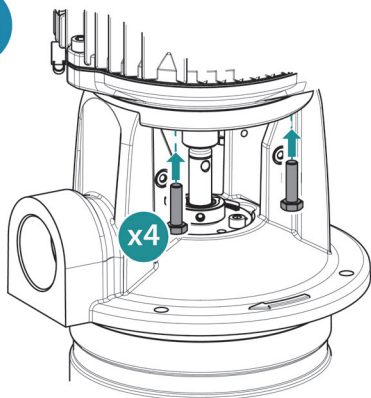


19

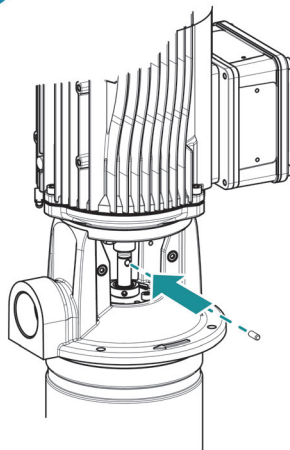


	 Nm (lbf-in)
M6	6 (53)
M8	15 (130)
M12	50 (440)
M16	80 (710)


20

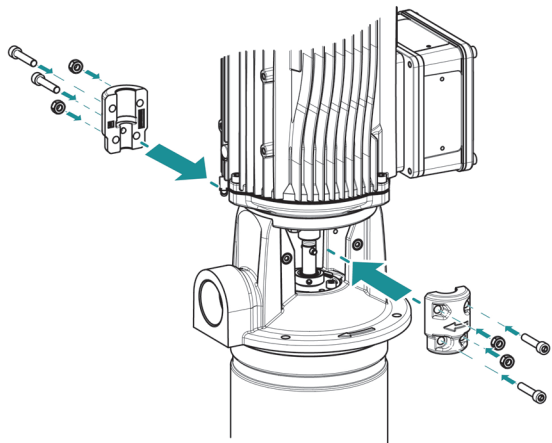




21

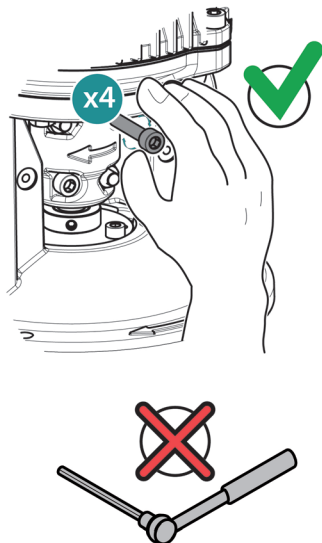


!

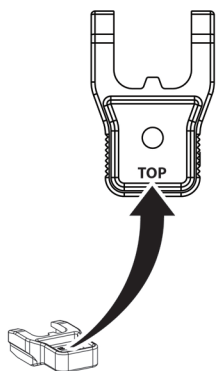


22

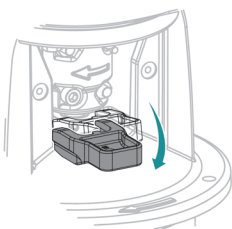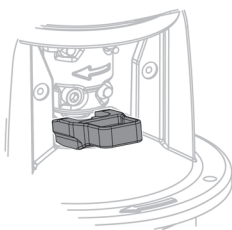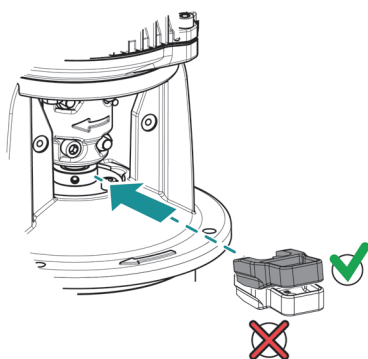

SVI_V0007_A_ph

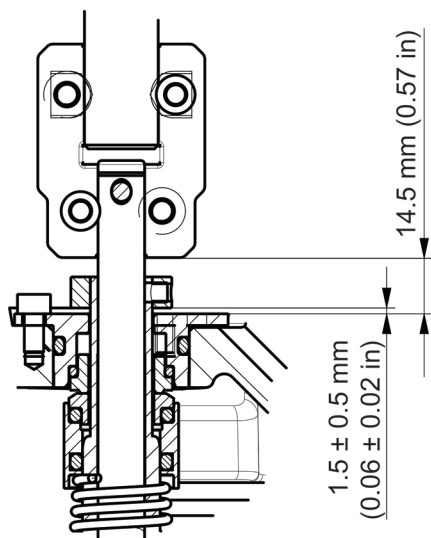


23

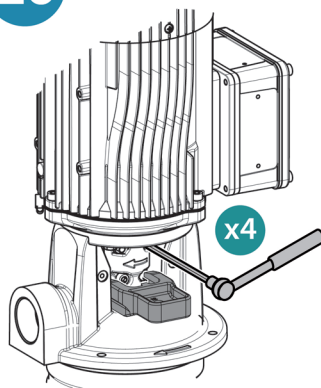


	 Nm (lbf·in)
M6	15 (130)
M8	25 (220)
M10	50 (440)

24

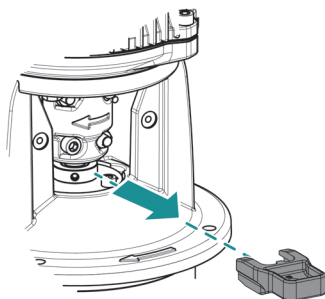


25

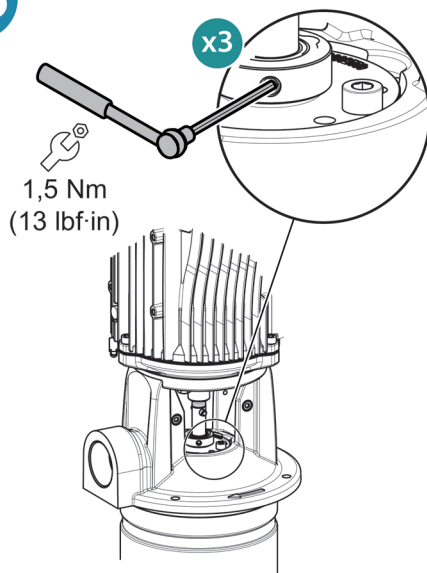

26



27


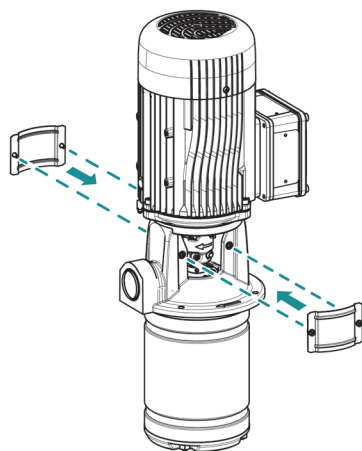





5-6-8-10
mm




6-8-12-16
mm

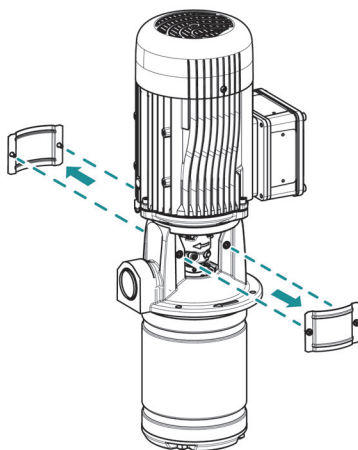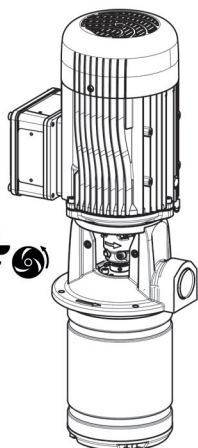


2

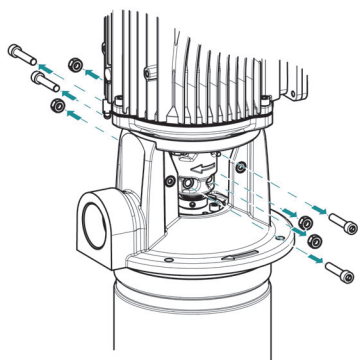


3




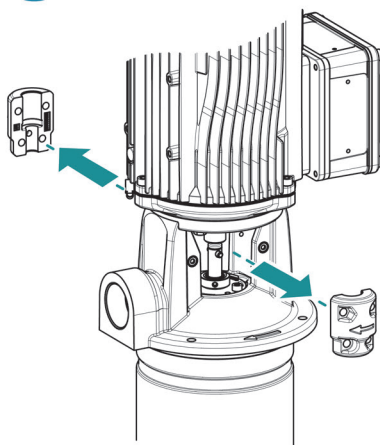


4

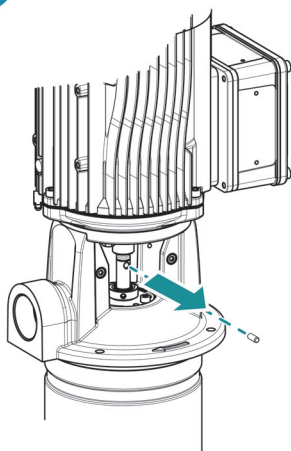


5

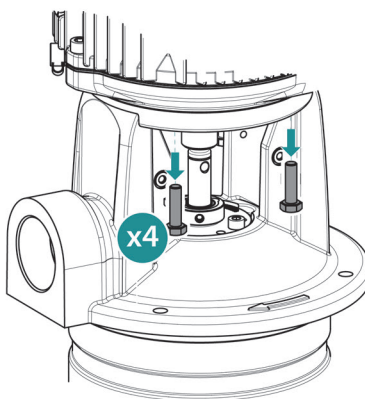

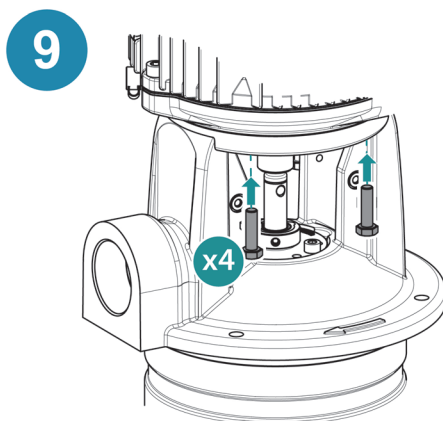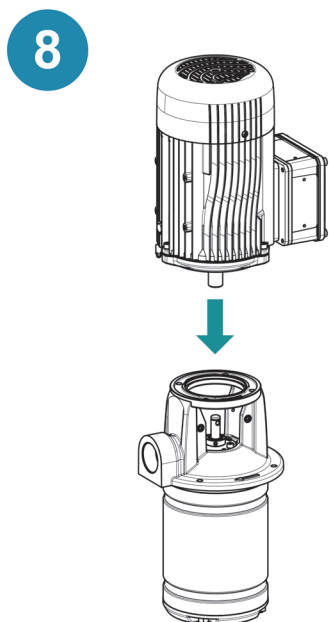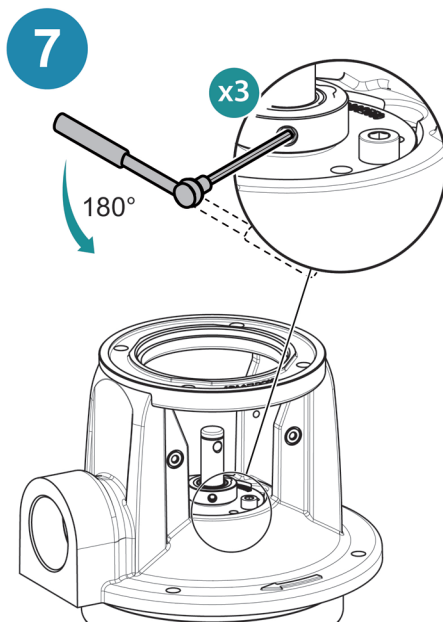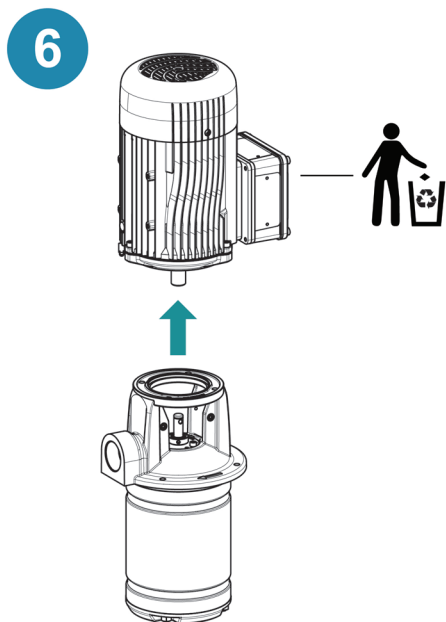


 	 Nm (lbf·in)
M6	6 (53)
M8	15 (130)
M12	50 (440)
M16	80 (710)


10

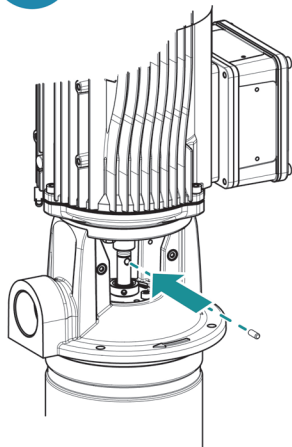


11





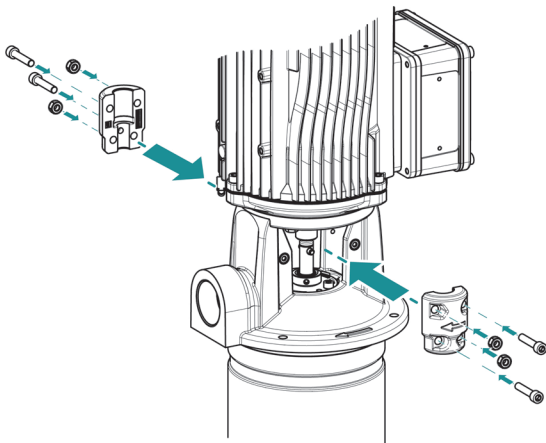


12

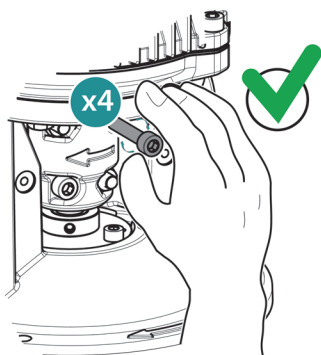


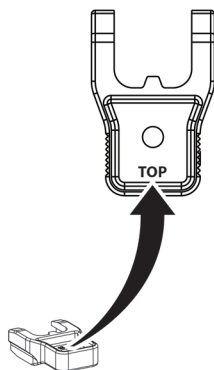

13

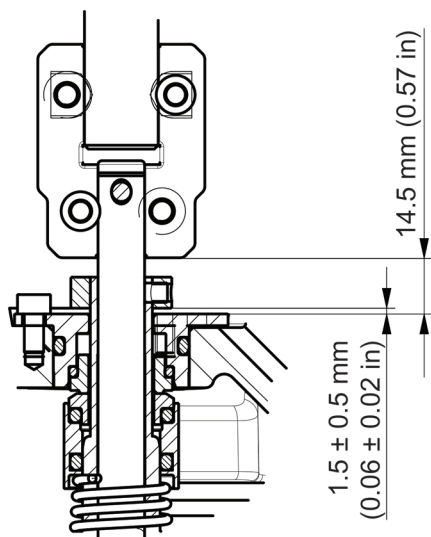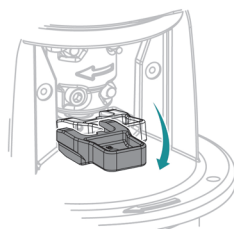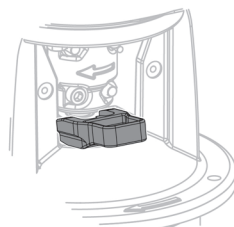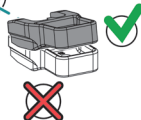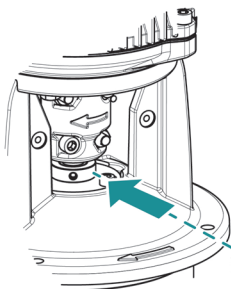


14

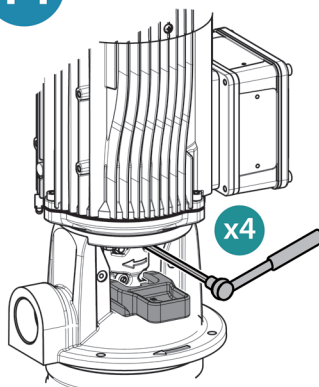


		Nm (lbf·in)
M6		15 (130)
M8		25 (220)
M10		50 (440)

15

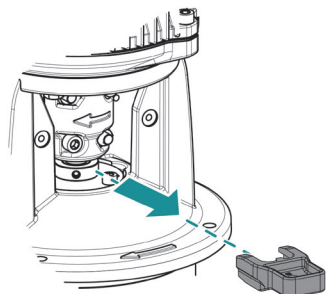


16

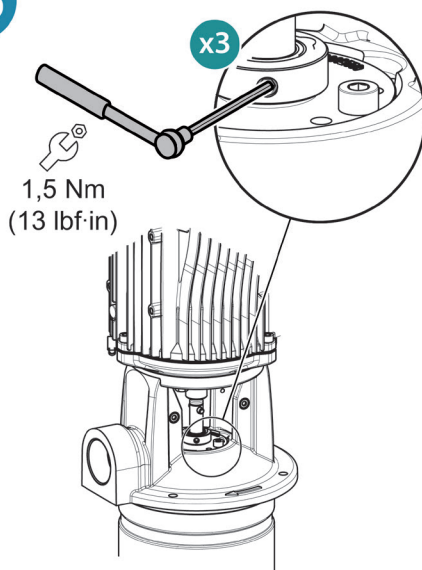

17



18

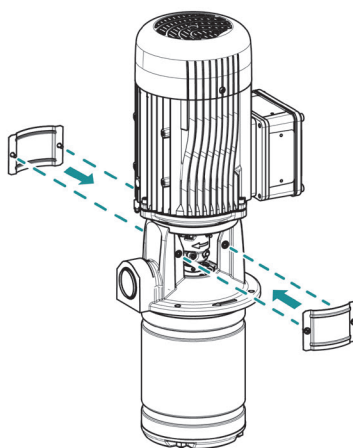





Xylem Service Italia S.r.l.
Via Vittorio Lombardi 14
36075 - Montecchio Maggiore (VI) - Italy
Tel: +39 0444 707111
Fax +39 0444 492166
www.xyleminc.com/brands/lowara
Visit our Web site for the latest version of
this document and more information
© 2021 Xylem Inc
Cod.001088016 rev.A ed.02/2021